Technical Information Bulletin

Subject: Feed Tray & Side to Side Registration **BULLETIN NO.: 137**

[ ] Factory Modification [ ] Field Modification [ ] Safety Information [X] Technical Information [ ] General Information [ ] Adv. Tech Information	Applies to: ALL GR - CE Units	Modification Schedule: [ ] TBS [ ] Next Call [ ] Next PM [X] As Necessary	Factory Installed_____ Field Installed_____ FittingTime _____

Background

Some Paper Feed Trays have excess side to side movement.
Excess side to side movement may effect side to side registration. This is noticable on a second pass.

Solution
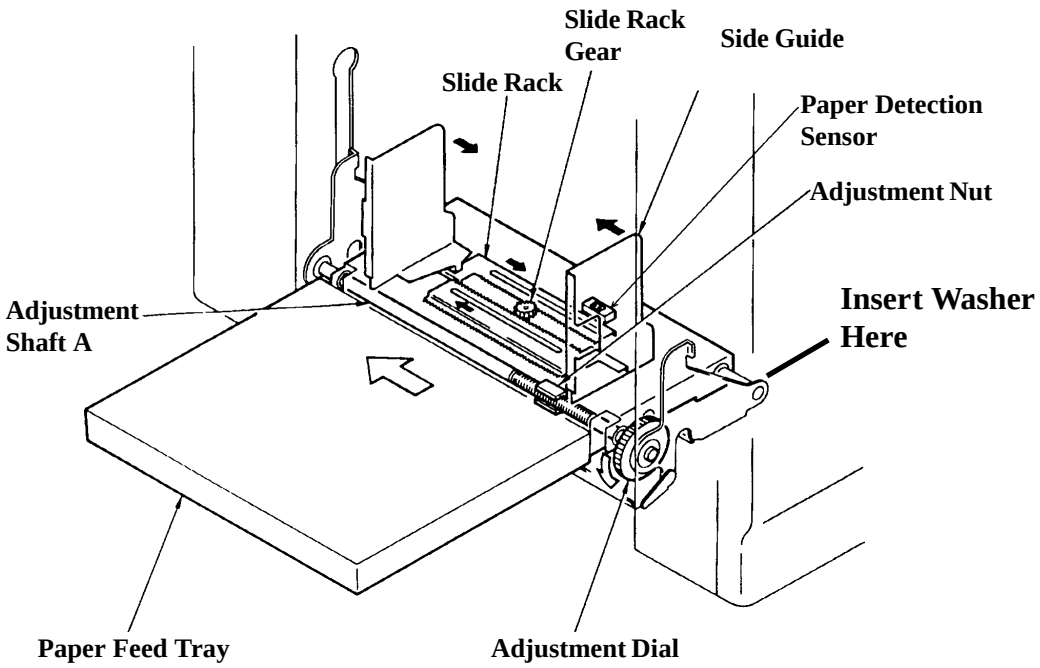
Insert a washer on the shaft between the C-clip and the paper feed tray.
The hole in the washer should be 10mm to 12mm, the outside diameter should be 14mm to 20mm and the washer thickness should be 1mm to 3mm.